



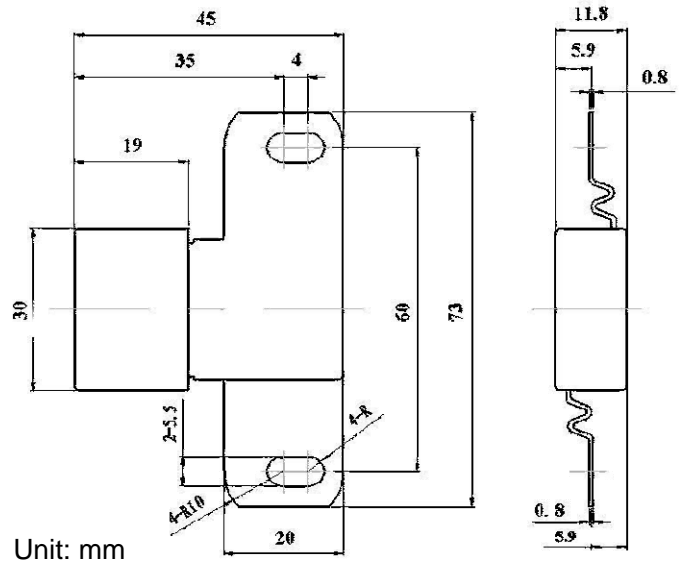

● TS series 100A

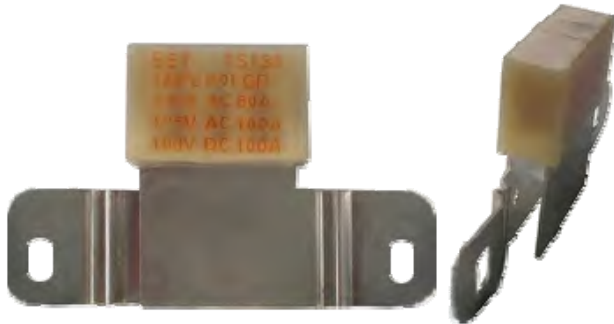

Model	Tf (°C)	Fuse-Temp (°C)	TH (°C)	TM (°C)	*Imax 8/20us (1 Time)	Ir (A)	Ur (V)	RoHS
TS102	102	99±2	61	180	100KA	80	250(AC)	●
						100	125(AC)	●
						100	100(DC)	●
TS115	115	112±2	74	180	100KA	80	250(AC)	●
						100	125(AC)	●
						100	100(DC)	●
TS123	123	118±2	82	180	100KA	80	250(AC)	●
						100	125(AC)	●
						100	100(DC)	●
TS125	125	122±2	84	180	100KA	80	250(AC)	●
						100	125(AC)	●
						100	100(DC)	●
TS130	130	126±2	88	180	100KA	80	250(AC)	●
						100	125(AC)	●
						100	100(DC)	●
TS136	136	132±2	94	180	100KA	80	250(AC)	●
						100	125(AC)	●
						100	100(DC)	●
TS150	150	146±2	108	180	100KA	80	250(AC)	●
						100	125(AC)	●
						100	100(DC)	●

Note: 1. Surge current(8/20us) is defined according to UL1449 3rd standard.
 2. The shape of connecting pole should be customized as required.